




*Pile-up assembly, part no. O295P9*

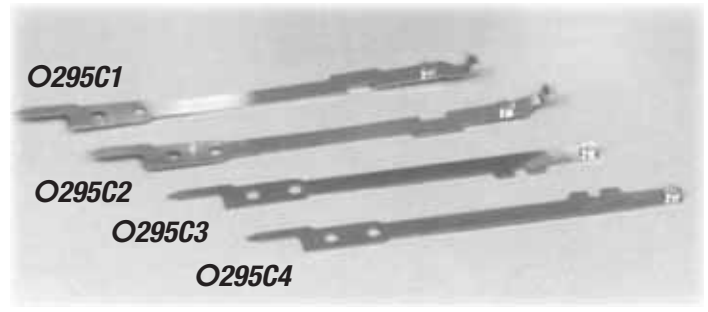

7055C PILE-UP ASSEMBLIES				
Adams part no.	Make/Break	Used on relay 7058B	Replaces Otis part no.	Supercedes Otis no.
<b>O295P1</b>	0M 8B	108, 208	7055C081	
<b>O295P2</b>	1M 7B	117, 217	7055C171	
<b>O295P3</b>	2M 6B	126, 226	7055C261	
<b>O295P4</b>	3M 5B	135, 235	7055C351	7055C205
<b>O295P5</b>	4M 4B	120, 220 124, 224 140, 240 142, 242 122, 222 144, 244	7055C441	7055C227 7055C241 7055C244 7055C406 7055C243
<b>O295P6</b>	5M 3B	153, 253	7055C531	7055C602
<b>O295P7</b>	6M 2B	160, 260 162, 262	7055C621	
<b>O295P8</b>	7M 1B	171, 271	7055C711	
<b>O295P9</b>	8M 0B	180, 280	7055C801	
<b>O292</b>	Plug-in base; incl. nut		306JL4	
<b>O293S1</b>	Compression spring, 1 1/4" L; see listing & photo on page 234		90XA14	


CONTACT ARMS WITH 5/32" SILVER CONTACTS*		
Adams part no.	Otis part no.	Description
<b>O295C1</b>	179CH2	Stationary, 4 11/64" L
<b>O295C2</b>	179CH4	Stationary, 4 11/64" L
<b>O295C3</b>	179CG2	Movable, 3 27/32" L
<b>O295C4</b>	179CG4	Movable, 3 27/32" L

\*Sold only in packages of 10.




*Plug-in base, part no. O292 (two shown)*

### REPLACEMENT COILS FOR 7058B "SLIM LINE" RELAYS



**H2101**  
2-lead coil



**H2158**  
4-lead coil

7058B REPLACEMENT COILS		
Adams part no.	Replaces Otis no.	No. of turns/wire size
<b>Two-Lead Coils</b>		
<b>H2101</b>	222FF1	10,940/41
<b>H2105</b>	222FF5	2,736/35
<b>H2106</b>	222FF6	860/29
<b>H2107</b>	222FF7	12,432/40
<b>H2108</b>	222FF8	6,420/37
<b>H2109</b>	222FF9	9,345/39
<b>H2111</b>	222FF11	3,192/34
<b>H2112</b>	222FF12	4,136/36
<b>H2113</b>	222FF13	780/28
<b>Four-Lead Coils</b>		
<b>H2154</b>	222FD4	Inner: 1,776/40 Outer: 10,064/40
<b>H2157</b>	222FD7	Inner: 3,204/39 Outer: 6,942/39
<b>H2158</b>	222FD8	Inner: 644/41 Outer: 9,078/39